

Manhole Inspection Summary

Manhole # S29M__027MH

Printed On: 3/9/2009

Page 1 of 4

Inspection ☐ Is Incomplete Rating: **3) Fair**

Record Plat: **29M** Node: **027** Status: **Found**

Insp Date: **12/15/08 10:57 AM**

Incomplete Comments

Crew: **WJ,DH**
Inspector: **wjenkins**
Firm: **PER**

Location Address: **654 S Paca St**

Cross Street: **S Fremont St**

Manhole Type: **Junction**

Location: **Roadway**

Ground Conditions: **Dry**

☐ Prev. Rehab

Weather: **Dry**

Subject To Ponding: **None**

Comments

Cover

Shape: **Circular**

Diameter: **25.** (in.) Length: **0** (in.) Dist A/B Grade: **0** (in.)
75

Type: **Sanitary**

Condition: **Sound**

Cover Material: **Cast Iron**

Properties: ☐ Bolted ☒ Vented ☐ Water Tight ☐ Water Tight Insert

Frame

Offset: **0** (in.)

Condition: ☒ Sound ☐ Cracked ☐ Leaks

Chimney / Frame Adjustment

☒ Exists Material: **Brick**

☐ Parged Height: **8** (in.)

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

Corbel

Material: **Brick**

☐ Parged

Type: **Concentric/Eccentric**

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

Barrel

Material: **Brick**

☐ Parged

Shape: **Circular**

Diameter: **52** (in.) Length: **0** (in.)

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

Bench

☒ Exists Material: **Brick**

☐ Parged

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris

Channel

Material: **Brick**

☐ Parged

Channel Exposure: **Fully Open**

Junc Dist: **0**

nearest .5 ft.

Azimuth: **0**

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris

Steps

Count: **8**

Missing: **0**

☒ **Corroded**

Surcharge

☐ Evidence Of Surcharge

Depth: **0** (ft.)

☐ Active Surcharge Present

Location View



Top View



lid pic



wrong cover lid is not storm drain

Misc



debris on bench and liquid

Defect 2



corroded rungs

Manhole Inspection Summary

Manhole # S29M__027MH

Printed On: 3/9/2009

Page 3 of 4

15 in. Circular Gravity Sewer
Pipe Out @ 12 O'Clock

12 O'Clock Outflow



Pipe Height: **15.6** (in.) Rod and Bar (Angled)
Pipe Material: **Clay** ☐ Pipe Lined
Invert Depth: **14.59** (ft.) Flow Characteristics: **Fast**
Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease
Silt Depth: **0** (in.) Deposits Extent:
Infiltration: **None** Pipe Seal Cond: **Sound**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection

15 in. Circular Gravity Sewer
Pipe In @ 4 O'Clock

4 O'Clock Inflow



Pipe Height: **15.6** (in.) Rod and Bar (Angled)
Pipe Material: **Clay** ☐ Pipe Lined
Invert Depth: **11.84** (ft.) Flow Characteristics: **Fast**
Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease
Silt Depth: **0** (in.) Deposits Extent:
Infiltration: **None** Pipe Seal Cond: **Sound**

Drop In @ 4 O'Clock



Drop: **Outside** Rod and Bar
Angled: **Yes** Reading: **13.24** (ft.)
Inv Depth: **14.24** (ft.)
Drop Condition: **Open**

Connects To: **Manhole**

☐ Possible Illicit Connection

Manhole Inspection Summary

Manhole # S29M__027MH


Printed On: 3/9/2009

Page 4 of 4

10 in. Circular Gravity Sewer

7 O'Clock Inflow

Pipe In @ 7 O'Clock

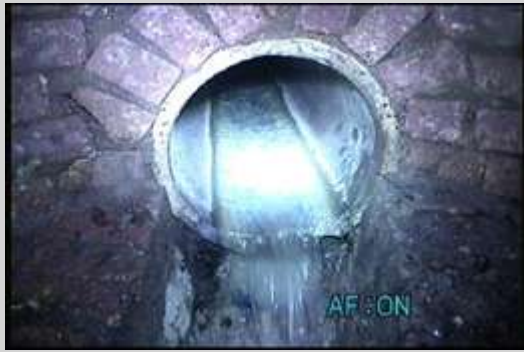

Pipe Height: **10.8** (in.) Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **13.22** (ft.) Flow Characteristics: **Fast**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: **0** (in.) Deposits Extent:

Infiltration: **None** Pipe Seal Cond: **Sound**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection

8 in. Circular Gravity Sewer

11 O'Clock Inflow

Pipe In @ 11 O'Clock



Pipe Height: **8.4** (in.) Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **14.34** (ft.) Flow Characteristics: **Slow**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: **0** (in.) Deposits Extent:

Infiltration: **None** Pipe Seal Cond: **Unknown**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection